

Fig. 6. Errors downstream of a conical contraction.

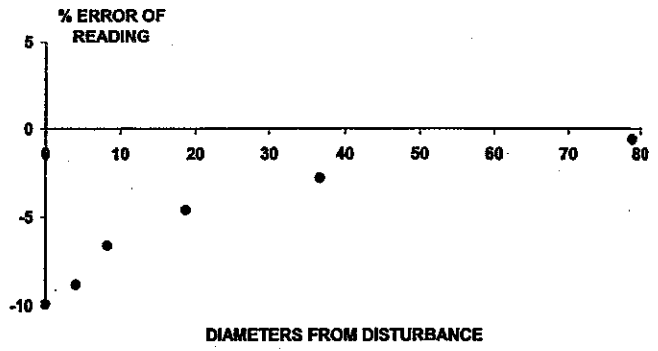


Fig. 10. Errors from two 90 degree bends in perpendicular planes.

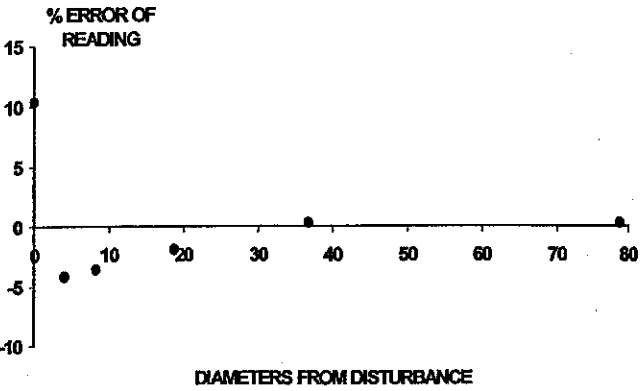


Fig. 7. Errors downstream of a conical expansion.

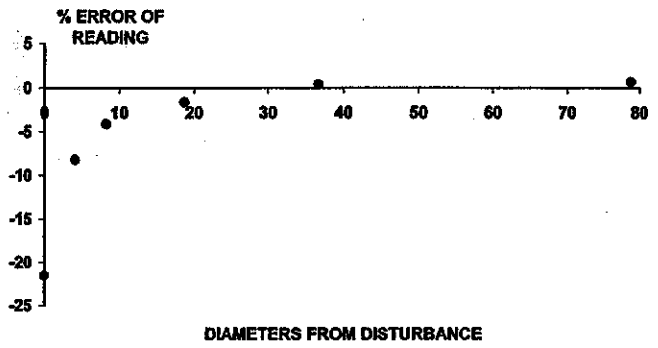


Fig. 11. Errors downstream of a butterfly valve 2/3 open.

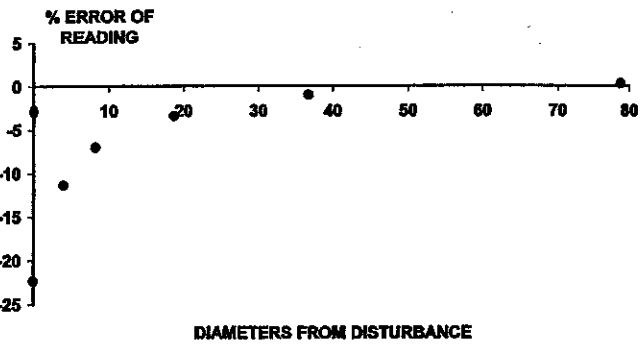


Fig. 8. Errors downstream of a single 90 degree bend.

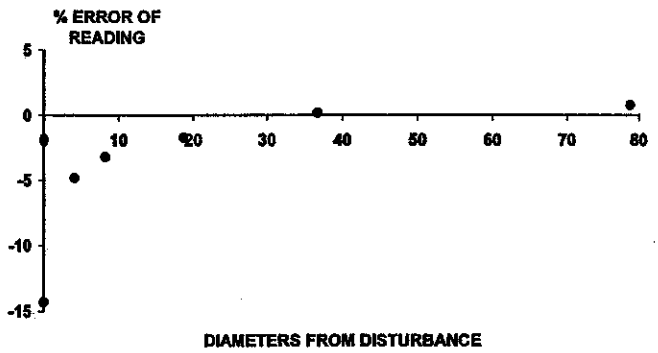


Fig. 12. Errors from a butterfly valve 1/3 open.

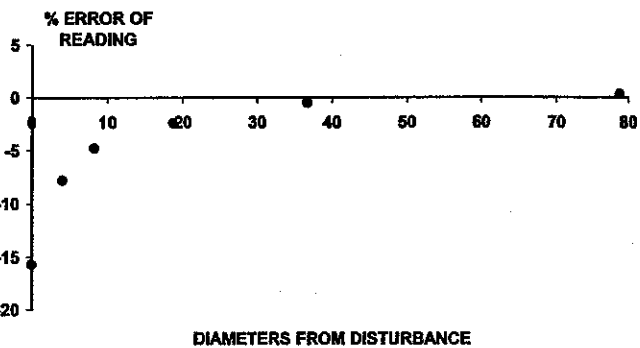


Fig. 9. Errors downstream of two 90 degree bends in 'U' configuration.

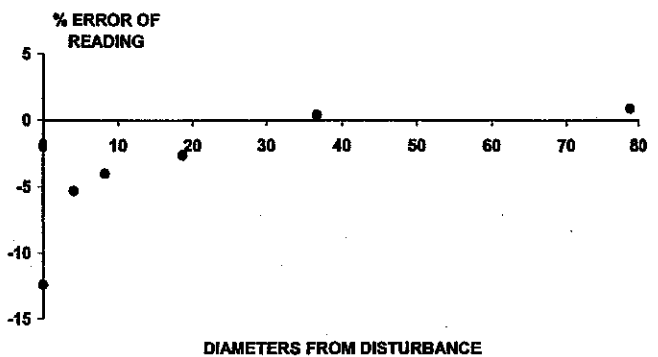


Fig. 13. Errors downstream of a gate valve 2/3 open.